

Thermocouple type J G3/8 " with PFA cable

Order nr.: 803170 3111


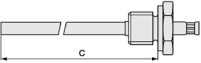
Screw-in thermocouples measure the temperature in pipelines or vessels. PFA cable can be used up to +260 °C. They are robust, acid-resistant, flexible and a good alternative to silicone cables. To configure your screw-in thermocouple for your measurement task, simply select the required configuration features and send us the order code.




General Information	
Measuring range	-40 °C to +260 °C
Perm. °C range cable	-50 °C to +260 °C
Accuracy	-40 °C to +375 °C: ±1,5 °C according to DIN IEC 60584 Class 1
Response time	t63 / t99: information is available on request
Pull-out force	≥ 30 N
Supply and output	
Measuring element	Thermocouple Type J
Measuring point	Measuring point isolated
Measurement signal	Thermovoltage
Ambient conditions	
Protection class	IP54 according DIN 60529 (depending on cable)
Humidity and moisture condensation resistance	according to application-specific qualification
Certificates and Standards	
Standards	DIN EN 61326-1:2013 DIN EN IEC 63000:2019-05
Directive	RoHS 2011/65/EU 2014/30/EU
Certificates	Certificate of suitability (on request)

Customizable options
C - Mounting length
E - Material connection cable
F - Length connection cable
G - Connector
H - Bend protection



Screw-in thread					
	Screw-in thread		C - Mounting length		
	Material	Stainless steel 1.4301 SUS 304	Code	Length (mm)	
	Length (mm)	12	C0050	50 ¹⁾	
	Process connection	G3/8 "	C0100	100 ¹⁾	
	Wrench size	24	C0150	150 ¹⁾	
	Protection sleeve		C0200	200 ¹⁾	
	Material	Stainless steel 1.4571 316Ti	C0250	250 ¹⁾	
	Mounting length (mm)	please choose	C0300	300 ¹⁾	
	Ø (mm)	6 ²⁾	C0400	400 ¹⁾	
			C0500	500 ¹⁾	

Other mounting lengths on request | ¹⁾Tolerance ± 1% | ²⁾ Tolerance ± 0,1 mm

E - Cable material and configuration connection cable												
	Code	Type	Color	IP	From (°C) ¹⁾	To (°C) ¹⁾	Outside material	Material strand	Ø (mm) ²⁾	Q (mm ²)	Color strand	Ω / m ⁴⁾
	E8510	Thermocouple cable	Type J ³⁾	IP67	-50	+260	PFA	PFA	2,6	0,22	bk, wt	2,5




Insulation resistance: ≥ 100 MOhm at min. 100 VDC | ¹⁾Perm. range °C | ²⁾Tolerance ± 0,2 mm | ³⁾Color according to IEC 584 | ⁴⁾per thermocouple

RL / KS / 28.10.2021




F - Length								
Code	F010	F020	F030	F040	F050	F100	F150	F200
m	1	2	3	4	5	10	15	20


Other lengths on request

G - Connector					
Picture	Code	Feature	Picture	Code	Feature
	G01	Insulated end ferrules (50 mm)			
	G11	Mini-TC connector Type J bk		G31	TC connector Type J bk

Other connectors available on request

Technical drawing - Connector

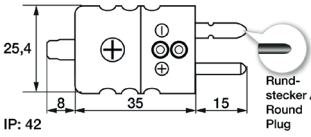

25,4
8 35 15
IP: 42
Rund-stecker / Round Plug

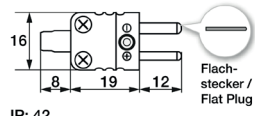
16
8 19 12
IP: 42
Flach-stecker / Flat Plug


H - Bend protection		
Picture	Length (mm)	Material
	50	Stainless steel spring 1.4310 SUS 302
	Code	Feature
	H0	Without (Standard)
	H1	Metal bend protection

Your order code					
Order nr.	Mounting length	Material connection cable	Length connection cable	Connector	Bend protection
803170 3111	C_____	E_____	F_____	G_____	H_____

Delivery and Assembly	
Delivery and Packaging	Probe, seperatly packaged in PE bag
Assembly instructions	per process connection
Important assembly advices	

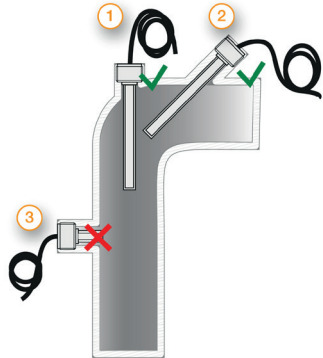

Measurement errors can occur due to heat dissipation to the environment. To keep these as small as possible, we recommend immersing the protection sleeve of your temperature probe as deeply as possible in the medium to be measured during installation. The optimum installation depth should be 10-15 times the Ø of the protection sleeve or, when using an immersion sleeve, the Ø of the immersion sleeve. When installing in pipelines whose Ø does not have a sufficiently deep installation depth, you should install the probe either at an angle or in a pipe elbow. Make sure that there is sufficient space for the probe to be removed. 1) Installation with sufficient installation depth 2) Installation at an angle with small pipe Ø 3) Not like this: Minimum installation depth not reached

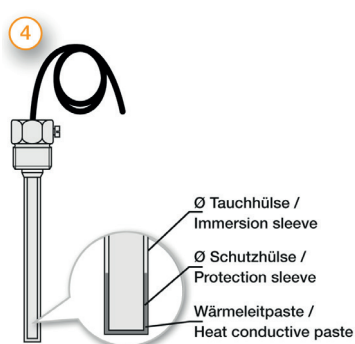


RL / KS / 28.10.2021

Installation by using an immersion sleeve (4): Please ensure that the Ø and length of the immersion sleeve are selected to suit the installation situation so that the minimum immersion depth can be achieved. Please also pay attention to the correct process connection. Since the probe is not inserted directly into the medium, but via the immersion sleeve, the response times are somewhat slower. The probe should be selected in such a way that the protection sleeve touches the bottom of the immersion sleeve and that the air cushion around the protection sleeve is as small as possible. The use of thermal paste can improve the response times. Please lay the cable in such a way that no water can penetrate the probe and with reserve loop (4). This allows you to extend the probe without disconnecting the electrical connection.


Technical drawing (All dimensions in mm)

Customizable options C - Mounting length E - Material connection cable	F - Length connection cable G - Connector H - Bend protection
---	---


Version with insulated end ferrules

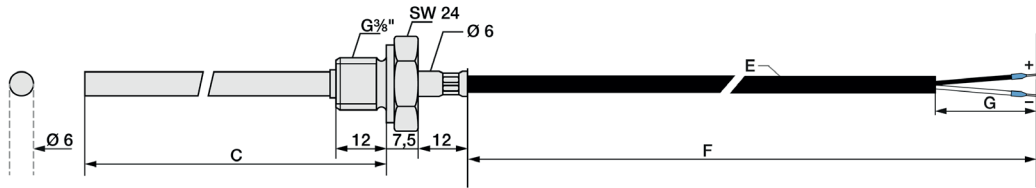



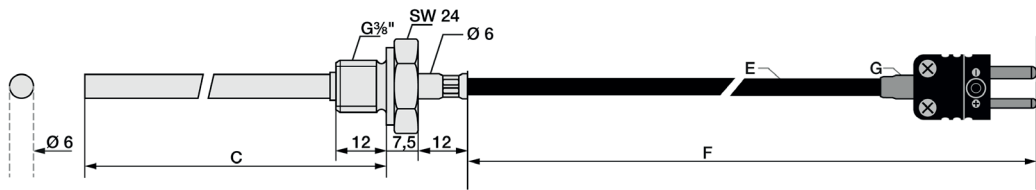

Version with mini TE connector

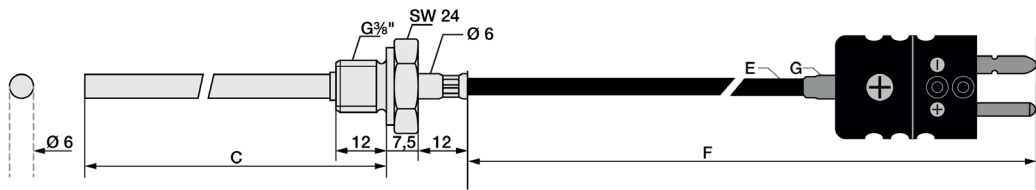

Version with TE connector



Matching accessories: Connector

Connector					
Picture	Code	Feature	Picture	Code	Feature
	809140 1000	Mini-TC connector Type J bk		809100 1000	Mini-TC coupling Type J bk
	809150 1000	TC connector Type J bk		809110 1000	TC coupling Type J bk


Other connectors available on request

Matching accessories: Heat-conducting paste


Heat-conducting paste		
	Article no.	809540 1000
	Content	10 ml
	Thermal conductivity	>2.5 W/mK
	Min / Max °C	-30 °C to +280 °C
	Thermal resistance	< 0.126

Details of accessories can be found on our website.


Technical drawing - Connector

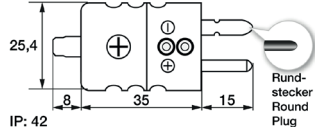


25,4
8 35 15
IP: 42
Rundstecker / Round Plug

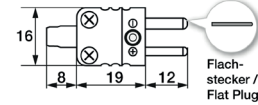

16
8 19 12
IP: 42
Flachstecker / Flat Plug

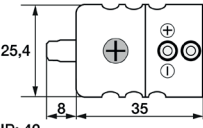

25,4
8 35
IP: 42



16
8 25,4
IP: 42

